



Global Advanced Research Journal of Geography and Regional Planning (ISSN: 2315-5018) Vol. 1(5) pp. 088-098, October, 2012  
Available online <http://garj.org/garjgrp/index.htm>  
Copyright © 2012 Global Advanced Research Journals

*Full Length Research paper*

# Localised Environmental Degradation Due to the Offshoots of Highway Development Projects: The Case of Central Ethiopian High Lands.

Solomon Addisu<sup>1</sup>, Mekuria Argaw<sup>2</sup>, Hameed sulayman<sup>3</sup>

1. Environmental Science; Bahir Dar University, Ethiopia (PhD, Research Scholar at Andhra University, India),  
2. PhD; Ecology; PO Box 1176; Addis Ababa Ethiopia
3. PhD in Environmental Science; PO Box 1176; Addis Ababa Ethiopia

Accepted 10 October, 2012

Ethiopia provides a well-known example of a severely degraded African environment with consequent implications for food insecurity and famine. Physical land degradation after road building has been observed in Central Ethiopian highlands through gully erosion. In this research work by using a number of methods such as Field observation, gully measurement, GIS technique, the 1997 and 2006 topomap and socio-economic questionnaires, the impacts of the road on land degradation has been studied. It investigates how highway construction in the Ethiopian Highlands affects the gully erosion risk by quantifying the catchment area before and after road construction, the number of gullies created, and its characteristics in two selected cases: Addis Ababa-Fiche and Addis Ababa-Ambo. Accordingly; since the building of the road, 17 new gullies were created immediately downslope of the studied road segments and 8 other gullies at a radical change in its dimensions. The average catchment area is now 58.28 hectares and 74.52 on the road segments of Fiche and Ambo respectively, which is significantly different ( $p < 0.001$ ) from the average pre-road catchment area of 8.45 and 14.52 hectares (paired average). The total surface area occupied by gullies in the side of Fiche road and in the side of Ambo road transects was about 63,892.6 m<sup>2</sup> and 59,214.25 m<sup>2</sup> respectively. The volume of soil loss was calculated between 12,530.38 m<sup>3</sup> and 71,420 m<sup>3</sup> from each road segments. The result of statistical analysis indicates that variation of the gully length contributed 95% of variation in the volume of soil loss. The Gully density (5.7m/ha to 14.06m/ha) implies that the sampled roadside areas were moderately to severely degraded. The damages and associated problems of the gullies, as explained by farmers, include loss of land, dissection of farms, and deposition of sediments on growing crops and in extreme cases putting agricultural fields out of production. Hence roads should be designed in a way that keeps runoff interception, concentration and deviation minimal. Techniques must be used to spread concentrated runoff in space and time and to increase its infiltration instead of directing it straight onto unprotected slopes.

**Keywords:** Gully erosion Risk, catchment area, Road design, Ecological destructions

## INTRODUCTION

Road is an important infrastructure for the economic development of a mountainous country like Ethiopia. The construction and maintenance of hilly and mountainous roads in Ethiopia are often challenged by its topography with very steep slopes, fragile geological conditions, and dynamics of geological and morphological processes.

Land degradation is a human induced or natural process which negatively affects the land to function effectively in an ecosystem. The link between a degraded environment and poverty is direct and intimate. As the land resource base becomes less productive, food security is compromised and competition for dwindling resource increases, and leads to potential conflict in the society. The most important on-farm effects of land degradations are declining potential yields. The threat of degradation may also be reflected in the need to use a higher level of inputs in order to maintain yields. Serious degradation sometimes leads to a temporary or permanent abandonment of some plots (Scherr and Yadav, 1996).

More than 90% of Ethiopia's population lives in the highlands including about 93% of the cultivated land, around 75% of the country's livestock and accounts over 90% of the country's economic activity. Land degradation is seriously threatening the economic and social development of the country as a whole (Hawando, 1997). The Ethiopian Highland Reclamation studies (EHRS) revealed that the Ethiopian highlands, which cover 44% of the country's total land area, are seriously threatened by soil and biological degradation (FAO, 1986). Some 27 million hectares representing approximately 50% of the highlands are already significantly degraded. Of this area, 14 million hectare are badly eroded and if the trend of soil degradation continues, per capita income in the highlands will fall by 30% in 20 years time, (FAO, 1984), fifty percent of the remaining highlands are highly susceptible to erosion.

According to Peter and John (2002), for rill and sheet erosion, road surfaces is the cause; whereas for gully erosion risk, road culverts and ditches are the major cause. Culverts and cross drainage channels are used to convey water from one side of a road to the other. This is accomplished by conveying water under the road through the culvert, or by allowing water to flow over the road using a ford, water bar, or dip. Ditch is a long narrow channel dug in the ground parallel to a road usually used for drainage and as a boundary marker. Good ditches make good roads. Properly designed and constructed ditches serve a number of essential purposes.

## Study Area


The proposed road projects are found in the Oromiya regional state of central Ethiopian Highlands. Both road projects were rehabilitated recently by the Ethiopian government and foreign companies. The commencement date for the Addis Ababa to Fiche road rehabilitation was 1999 and the completion date was 2004. And that of Addis Ababa to Ambo road rehabilitation commencement and completion date was 2002 and 2006 respectively. This road project is found in North Shewa Zone of Oromiya Regional State in Central Ethiopia. It was originally built by the Italians and partially rehabilitated by Ethiopian government in different times. It is part of the road that connects Addis Ababa to Bahir Dar and Gonder. The total length of the proposed road is 113 kilometers, some kilometers of the road segment are completely changed and others are reconstructed over the former. 81% of the road segments are crossing farmland and grazing land; and the remaining road segments are crossing built up land and reforested land. 35% of the road segment is also constructed by following a new route alignment; whereas the remaining road segments are constructed over the former alignment but a complete destruction and reconstruction was made during rehabilitation. This road project is found in the West Shewa Zones of the Oromiya Regional State in Central Ethiopia. The Addis Ababa – Ginchi - Ambo Road was originally built in the 1930's by Italians with a base varying from 4 to 6 m width. In the 1950's and 1960's, the road was partially rehabilitated and upgraded to bitumen standard. The existing road is some 102km long and passes through the Western Shewa Zone in a westerly direction. As one drives from Addis Ababa to Ambo, the road passes through the major towns of Holeta, Addis Alem and Ginchi. route, the road passes through some 33 kms of flat area, 66 kms of rolling to hilly terrain and 3 km of hilly to mountainous terrain.

The major towns, such as Addis Alem, Holeta and Ginchi through which the road passes, have populations of 8,447, 20,896 and 164,441 respectively. The road passes through 3.7 km of bush land, 21.3 km of built-up area, 35.6 km of farmland, 15.7 km of re-afforested land and 42.1 km of grazing land.

Altitude is one of the major factors that determine the temperature of the area. About 50 percent of the North and West Shewa lies in Weina Dega Region (altitude 1500-2500m) whilst Kolla (altitude 1500m) and Dega (altitude 2300-3500) constitutes 50.3, 16.7 and 33 percent respectively. The average annual temperature of the study area ranges from 16.4 to 25°C. The project area enjoys ranging from 813mm substantial annual rainfall to 1699mm. The dominant economic activity in the study area

---

\*Corresponding Author's E-mail: Soladd2000@yahoo.com

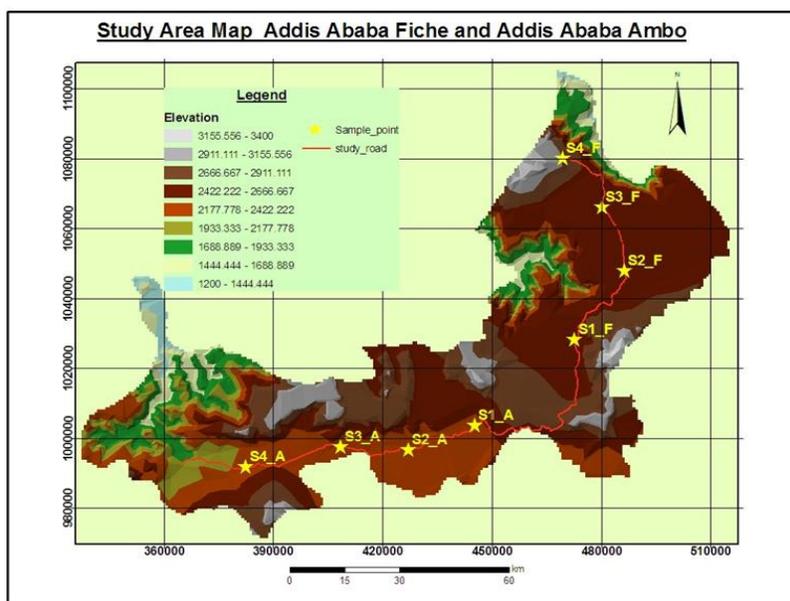

SA=Ambo site, SF=Fiche site),  
**Figure 1.** topography and drainage map of the study area.

is crop production integrated with livestock rising. The crop pattern and production depends on agronomic factors such as altitude, climate, soil and rainfall. A wide variety of crops are grown in the study area. However, crop production is at subsistence level. The major factors responsible for the low productivity are increase in population growth, land scarcity, loss of soil fertility and erosion problem, shortage of farm oxen, lack of agricultural inputs, occurrence of drought, erratic nature of rainfall and pest occurrence. Livestock husbandry is also an important sector of the area's economy.

## MATERIALS AND METHODS

The proposed road projects are found in the Oromiya regional state of central Ethiopian Highlands. Both road projects were rehabilitated recently by the Ethiopian government and foreign companies. The commencement date for the Addis Ababa to Fiche road rehabilitation was 1999 and the completion date was 2004. And that of Addis Ababa to Ambo road rehabilitation commencement and completion date was 2002 and 2006 respectively. Altitude is one of the major factors that determine the temperature of the area. About 50 percent of the North and West shewas lies in Weina Dega Region (altitude 1500-2500m) whilst Kolla (altitude < 1500m) and Dega (altitude 2300-3500) constitutes 50.3, 16.7 and 33 percent respectively. The average annual temperature of the study area ranges from

16.4 to 25°C. The project area enjoys ranging from 813mm substantial annual rainfall to 1699mm. The dominant economic activity in the study area is crop production integrated with livestock raising. The crop pattern and production depends on agronomic factors such as altitude, climate, soil and rainfall. A wide variety of crops are grown in the study area. However, crop production is at subsistence level. The major factors responsible for the low productivity are increase in population growth, land scarcity, loss of soil fertility and erosion problem, shortage of farm oxen, lack of agricultural inputs, occurrence of drought, erratic nature of rainfall and pest occurrence. Livestock husbandry is also an important sector of the area's economy.

This study was designed in the way that relevant and accurate information could be obtained about the adverse impacts of the road on the surrounding land use types. Accordingly, 4 sampled road segments with a radius of 1km were used at every 25km distance outside of any urbanized area along each road projects. For each sampled road segments a semi-structured questionnaire and open ended interviews were used to collect data from households and focus groups and experts working in governmental and nongovernmental organizations respectively. Gullies were quantified and measured with respect to slope, land use type, and soil texture. The boundary of watersheds, the drainage area of gully heads

**Table1.** Summary of Gully characteristics in each sampled segments on Fiche road site

Gully characteristics	Segment 1	Segment 2	segment 3	Segment 4	mean	st. dv.
No. Gullies	2	4	4	4		
Total length(m)	1780	4348	4415	5425	3992	1554.79
Average width(m)	3.83	3.33	3.72	3.76	3.66	0.2247
Average depth (m)	1.80	2.40	2.45	1.78	2.11	0.367
Surface area(m <sup>2</sup> )	7167.4	16080.5	16757.3	23887.4	15973.15	6850.86
Volume(m <sup>3</sup> )	12530.38	36206.29	39830.16	40883.78	129450.6	13372.43
Area ratio	0.00023	0.00512	0.005340	0.00761	0.0046	0.0031
Density (m/hect)	5.70	13.85	14.06	17.28	12.72	4.938

and gullies before the rehabilitation of the roads were determined on the topographic maps with a scale of 1:25000 using Arcview and ArcGIS softwares. The geographic coordinate systems and the elevation of the selected sites were taken from the center of each road segments using Geographic positioning system (GPS) during the field survey.

The gully head area with and without road were done by using Raster Calculator of Arc GIS spatial analysis tool. Information on the exact position of gully heads and road culverts in the study area collected during the 2009 field survey was then used to reduce errors when manually deriving the drainage area from a digital elevation model.

The contour map of the study area is derived from SRTM (Shuttle Radar Topographic Map) data. First SRTM data was exported from DEM software to Arc GIS 9.2 and converted in to a raster DEM data format using the spatial analysis tools; surface analysis in Arc GIS 9.2 Arc toolboxes. And finally a 10m contour interval is generated using surface analysis tools. This made possible in the determination of the natural drainage pattern, the drainage area of the gully head with and without road, the concentrated runoff (gullies), the sediment deposited (debris cone), and the redirected flow patterns.

A semi structured questionnaire was used to collect data from the rural households which are found along the roadsides. The sample households of the two roads were taken from each road segments outside of any urbanized area. From each sampling site, questionnaires were distributed at every fifth households and the perceptions of the farmers on physical land degradation were collected.

In the Analysis part, the correlation between the volume of gully erosion as dependent variable and morphometric characteristics of gullies as independent variables was considered using stepwise method in SPSS software statistical analysis to identify the significant and useful index to estimate the volume of gully erosion. US-SCS (1966) by using width per depth (W/D) ratio of erosional channels found that in the cohesive soils, the width of the

gullies is 3 times of their depth while in non-cohesive soil, this ratio is 1.75 times (Relationship 1 and 2).

$$D=0.34W \text{ ----- cohesive soil (1)}$$

$$D=0.57W \text{ -----non-cohesive soil (2)}$$

Radoane *et al.* (1990) presented a linear relationship between W/D and gully length (relationship 3).

$$W/D=1.287 + 0.00199L \text{ ----- } R^2 =0.39 \text{ (3)}$$

Also, correct estimation of gully length would estimate the gully cross section correctly. Nachtergaele *et al.* (2001b) in their research found a power relationship between gully volume and gully length (equation 4)

$$V = a L^b \text{ (4)}$$

Where;

D=depth, W= width, L= length

V=volume, and a and b= parameters which take different values under various.

Environmental conditions

On the other hand, data obtained from GIS technique, which were used for calculation of basin area boundary of each gully head before and after the construction of the road using the three dimensional approach (DEM), was analyzed and the difference in (unpaired) average values tested for its significance by t-test (Diem, 1963; Beguin, 1979).

## RESULTS AND DISCUSSION

relationship ( Table 3) implies that gully widening is happening along the road sides. In other words, the risk of land degradation (rangeland and rain fed farms) is higher in these regions. Also, there is a linear relationship between W/D ratio and gully length (Table 3). It implies that with increasing one unit in the gully length, 0.66 unit of W/D ratio will be increased.


The volume of gully erosion had a significant correlation with length, top and bottom width (P<0.01) and with from

**Table2.** Summary of Gully characteristics in each sampled segments on Ambo road site


Gully characteristics	Segment 1	Segment 2	segment 3	segment 4	mean	St.Dv.
No. Gullies	2	3	3	3	-	-
Total length (m)	2859	3840	3705	4117	3630.25	542.031
Average width (m)	3.68	3.61	4.73	5.00	4.26	0.714
Average depth (m)	2.1	2.2	3.55	2.6	2.61	0.661
Surface area (m <sup>2</sup> )	10969.5	16466.8	19509.15	12268.8	14803.56	3917.226
Volume(m <sup>3</sup> )	25528.56	31733.14	71420.27	61205.35	47471.83	22296.12
plot to area raio	0.0035	0.0052	0.0062	0.0039	0.0047	0.00124
Density (m/hect)	9.11	12.23	11.80	13.11	11.563	1.724

**Table 3.** Relationship between morphometric parameters of the gullies


	standard coefficient	R2	P
D=2.146 + 0.173W	0.55	0.26	0.05
W/D=2.27 + 0.006L	0.66	0.41	0.05

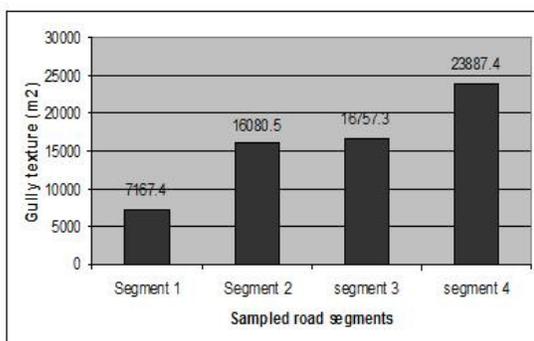

Gully Texture area covered along Fiche road site

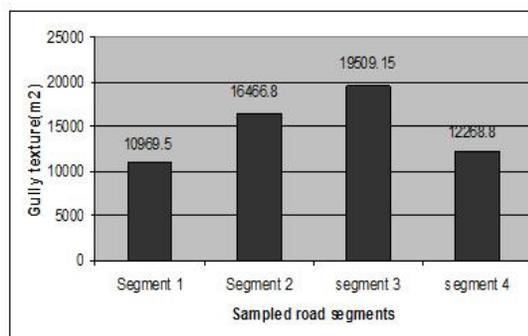


Gully Texture area covered along Ambo road site

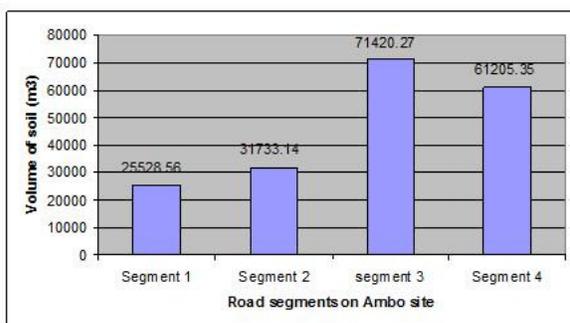

Volume of soil lost in m<sup>3</sup> Fiche site.

**Figure 2.** Volume of soil lost in the sampled sites

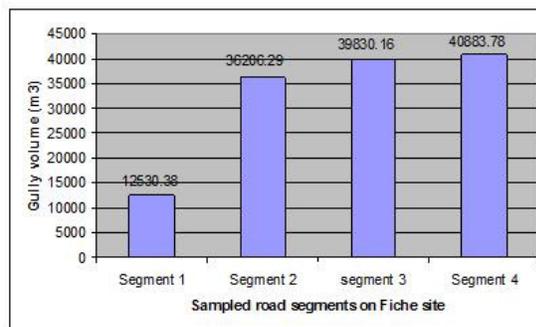

Volume of soil lost in m<sup>3</sup> From Ambo site.

factor, D/wt (P<0.05). The simplest linear equation existed between the volume and length of gullies indicates that more variation in the volume of gully erosion was due to the length of gullies. In addition to gully length, gully depth R<sup>2</sup> increased to 0.980 but with adding gully top width (Wt),

to the relationship, R<sup>2</sup> was not increased significantly (Table 4).

As shown in the table blow, the area drained to the gully head before road construction are smaller than after the road has been constructed. The average catchement area

**Table 4.** volumes of gully and its morphometric characteristics

variable	( $\beta_1$ )	( $\beta_2$ )	( $\beta_3$ )	R2	P
L	0.931			0.870	0.01
L,D	0.966	0.326		0.980	0.01
L,D,W	0.872	0.217	0.158	0.978	0.01

**Table 5.** Gully head drainage area

Ambo Site					Fiche site				
Road segments	Gully head	Drainage area after the Road(hec)	drainage area before the road(hec)		Gully head	Drainage area after the Road(hec)	drainage area before the road(hec)		
1	2	68.55	8.89		2	71.00	11.20		
2	3	87.99	16.40		1	30.56	6.48		
3	2	76.00	21.34		2	56.89	7.45		
4	2	65.55	11.45		3	74.67	8.78		
Mean		74.52	14.52			58.28	8.45		
St .dv.		9.99	5.51			20.05	2.02		

is now 58.28 hectares and 74.52 on the road segments of Fiche and Ambo respectively, which is significantly different ( $p < 0.001$ ) from the average pre-road catchment area of 8.45 and 14.52 hectares (paired average). The higher drainage area implies that higher volume of water is flowing with higher speed towards the culvert and very long gully are created down slope of the road.

On the other hand, the data obtained from semi structured questionnaire shows that Soil erosion is a common problem in both study areas. (80.6%) on Fiche site and 83.3% of farmers on Ambo site perceived that gully erosion is observed on their field after the roan has been constructed. Regarding the causes of gully formation, most respondents mentioned that water from the road surface and culverts (89%), inappropriate drainage of culverts and ditches of the road (75.4%), and cut and fill of slope during road construction (54.0%) as important causes of gully development.

#### **Farmers' perception of physical Land Degradation After the road rehabilitation.**

In the final assessment, concepts of land resources, the interaction between human and land resources, problems and causes of physical land degradation, land resources management, sustainable agriculture, and infrastructure were discussed. Interviewed residents on both road sites

have common view and perception on the importance of infrastructural development such as road and its adverse impact on the environment. Participants of chancho, mukature, chagel ,keyu, and awaro describe land resources as physical and biological entity that include farmland , grazing land, forest, mountains, and vegetation from which human, domestic and wild animals sustain their lives. As of the interaction between human and land resources, they viewed that human beings obtain benefits from land such as food, fiber, wood for fuel and construction purposes. They also recognized that land provides sites for construction of houses and for other development activities. Meanwhile, they believe that the impact of human activity is degrading land resources.

Inappropriate drainage of culverts and ditches and concentration of water along the road are identified as the major proximate causes of physical land degradation through the formation of gullies. The exposure of land to erosive forces due to the above mentioned activities exacerbate the deterioration of the quality and size of the land.

On the other hand, the data obtained from semi structured questionnaire shows that Soil erosion is a common problem in both study areas. Farmers along Addis Ababa to fiche and to Ambo believe that they face problem of soil erosion in their farmland, grazing land, and forest. They infer the presence of soil erosion by rills and gullies,

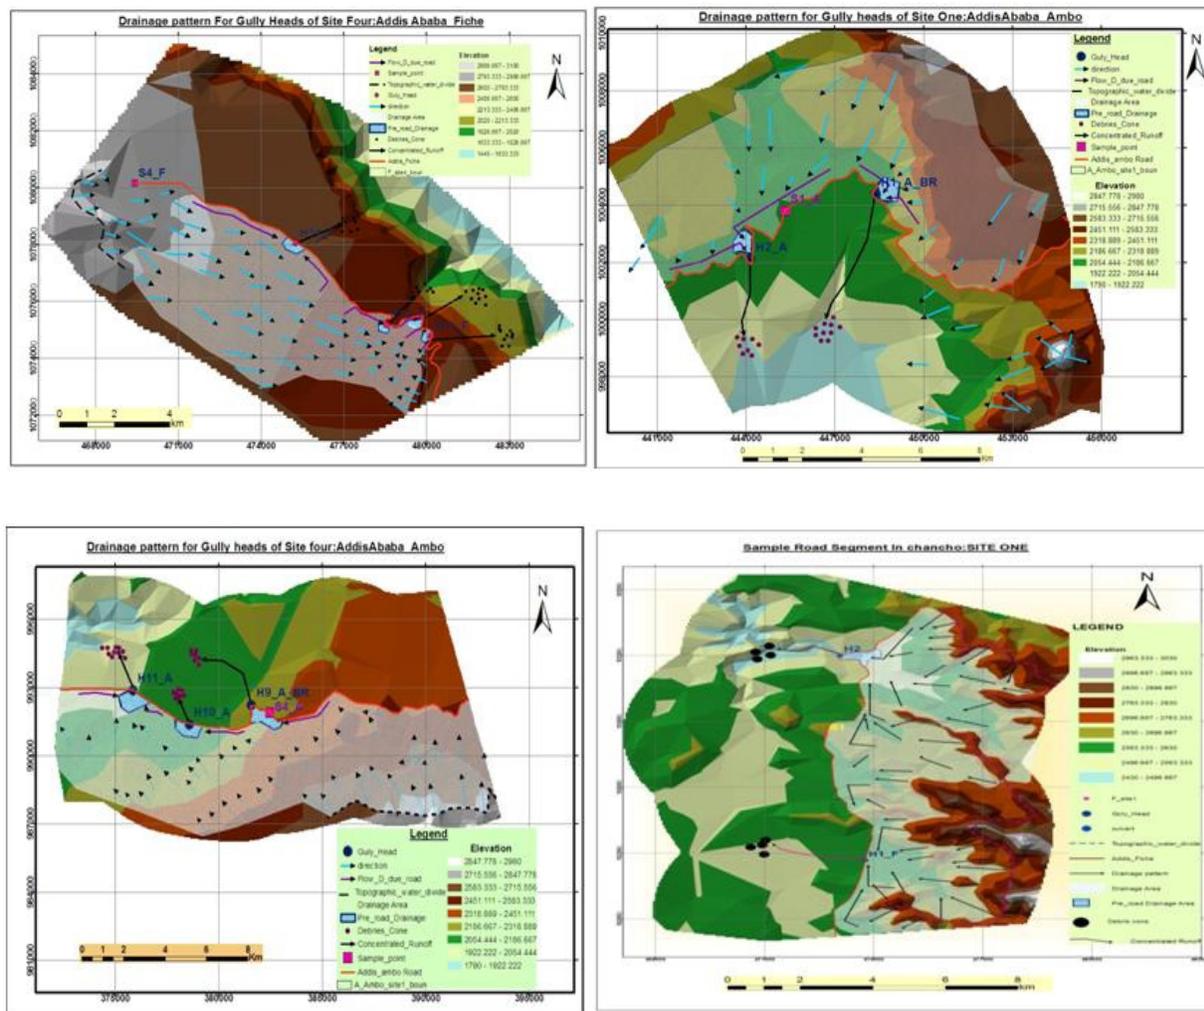


Figure 3. DEM of the sampled road segments

sheet erosion, and pedestals in their surroundings (Table 6 and 7).

As shown in table 6, almost all farmers (80.6%) on Fiche site road segments perceived that gully erosion is the dominate type of problem observed on their field. On the other hand, 83.3% of farmers on Ambo site perceived that gully erosion is observed on their field.

The measures taken to mitigate problems of soil erosion are not effective in the study areas. For instance, on the biophysical survey, it is observed that, land covered by gully system is totally lost for production purpose along the roadside land types due to the influence of the road construction and the absences of rehabilitation measures by the community.

As can be seen from Table 8, only about 7.2% of farmers indicate that there is no erosion problem on their farm land.

The remaining 93.8% of farmers perceived that there is at least low level of soil erosion problem on their cultivated land. This is more than or comparable to the findings of other studies made in different parts of the country. For instance, the study made in Gununo Area in SNNPR at the beginning of 1990s indicated that about 74% of farmers interviewed perceived soil erosion problem on their cultivation field (Belay, 1992). Recent study in Digil indicated that about 98% of farmers surveyed perceive the problem of soil erosion on their own farm (Woldeamlak, 2003). In the study area the perception of farmers about the degree of the problem of soil erosion is different among respondents. About two-third of farmers interviewed indicated that there is moderate or severe erosion problem on their farmland. About one-third of farmers interviewed (29%) rated the problem to be low on their cultivation land,

**Table 6.** Indicators of the presence of soil erosion as perceived by farmers on Fiche site

Farmers perception on erosion types in their field	No of respondents	% of farmers on erosion types in their field
Gullies	38	80.6%
Rills	4	8.6%
Sheet erosion	3	6.4%
Others	2	4.4%
Total	47	100

**Table 7.** Indicators of the presence of soil erosion as perceived by farmers on Ambo site

Farmers perception on erosion types in their field	No of respondents	% of farmers on erosion types in their field
Gullies	30	83.3%
Rills	3	8.5%
Sheet erosion	1	3.1%
Others	2	6.1%
Total	36	100%

**Table 8.** Farmers' Perception of Gully Erosion by Degree of Severity

Degree of Gully erosion problem	Frequency	%	Cumulative %
No Erosion	6	7.2	7.2
Low Erosion	14	16.9	24.1
Moderate Erosion	22	26.5	50.6
Severe	41	49.4	100
Total	83	100	

**Table 9.** Farmers' Identification of the causes of Gully erosion formation

no	Main cause gulying	Responses (%)*
1	water from the road surface and culverts	89
2	Population pressure	12
3	Lack of ditch and culvert layering	3.5
4	Cut and fill of slope during road construction	54
5	Inappropriate drainage of culverts and Ditch of the road	75.5
6	Over grazing and Deforestations	35
7	Increasing built up area around the road	45.5
8	Others	15

\* The sum may not add up to 100 % due to repeated responses

**Table 10.** farmers' identification of the time when gully appeared on their land

<i>no</i>	Time of gully appearance	Responses (%)*
1	Before the road construction	32
2	After the road construction	87
3	Before the road ,but the size significantly increased after the road construction	67
4	Not known	23

\* The percentages may not add up to 100 due to repeated responses

**Table 11.** problems faced on the farmers due to the formation of gully on their land

No	Types of problems faced	Responses (%)*
1	Decrease of the cropped area&/ loss of soil and yield	79.5
2	Obstruction of tillage operations	85.3
3	Restriction of movement from one farmland to the other	89.8
4	Taking away of materials by flooding during rainy season	45.5
5	Changing the natural beauty of the environment	44.5
6	Others	23

\* The sum may not add up to 100 % due to repeated responses

one-fourth of interviewees (about 26 %) indicated that there is moderate level of erosion and the remaining 37% indicated that there is severe erosion problem.

Regarding the causes of gully formation, most respondents mentioned that water from the road surface and culverts (89%), inappropriate drainage of culverts and ditches of the road (75.4%), and cut and fill of slope during road construction (54.0%) as important causes of gully development. Significant number of farmers (about 45.5%) also perceived increasing built up area around the road as a cause of gully formation.

According to the above table, 87.0% of the respondents had ever seen gully on their land before the road construction, 67.0% of the respondents said that gullies were on their land before the road but brought significant change in the length, depth, and width after the road construction.

Regarding the problem of gully, 79.5% of the respondents faced decrease of the cropped area and loss of soil and yield, 85.3% have obstruction of tillage operations, and 89.9% of the respondents are restricted movement from one farmland to the other.

Moreover; The damages and associated problems of the gullies, as explained by farmers during interview and observed in the field, include loss of land, dissection of farms, deposition of sediments on growing crops and in extreme cases putting agricultural fields out of production. Risks of falling into the gully for children and animals, increased distance to travel from the village and the

associated burden to women are other problems. Additionally, farmers explained that crops growing close to the gullies usually dry up before reaching to full maturity and they believed that wind blowing through the gully has the capacity to dry up their crops.

## CONCLUSION AND RECOMMENDATIONS

Physical land degradation features which were observed along the studied roads were mass failure /landslide/, sloughing, rilling and gullying. However; it has been noticed that gully erosion was found to be the most important causes of degradation. The road between Addis Ababa to Ambo and to Fiche in the highlands of Northern and Western Shoa (Central Ethiopia), built in 1999-2004, caused gulling at most of the culverts and other road drains. While damage by runoff to the road itself remains limited, off-site effects are very important. The road induces a concentration of surface runoff, a diversion of concentrated runoff to other catchments, and an increase in catchment size, which are the main causes for gully development after road building.

Therefore, with a responsibility for the sustainability of whole society, the environmental protection will be deemed as one of the important factor in the procedure of road planning, design, construction, operation, administration and scientific research. We should fully consider the saving of resources and energies, diminish pollution of air, sound,

water and soil, and reduce influence of road to scene. We should also consider the influences of road to animal and plant, human society and soil, develop eco- friendly road system. Ethiopia, as a mountainous country, has different landforms which are a strong obstacle in the construction of road transport system. Hence roads should be designed in a way that keeps runoff interception, concentration and deviation minimal. Techniques must be used to spread concentrated runoff in space and time and to increase its infiltration instead of directing it straight onto unprotected slopes. Set out recommendations listed below for construction sites and rights-of-way:

- Construction contractors should contain erosion and sediment control requirements and fully application of the law of rural road construction.
- Proper road construction design and as many culverts as possibly construction to minimize concentration of runoff by decreasing the drainage area.
- Road contractors must reach the concentrated runoff to the nearby natural water ways.

## ACKNOWLEDGEMENTS

Above all, always and forever my blessing and praise goes to the almighty God, who gave me all the stamina and everything I ever asked, to keep myself on track.

This study would never be completed without the contribution of many people to whom I would like to express my gratitude. First of all I would like to thank my advisor, Dr. Mekuria Argaw for guiding and educating me during the different stages of this thesis: ignition of the research idea, writing my proposal, conducting fieldwork and writing this thesis. The discussions and suggestions were helpful to get me back on track and structuring my thoughts. Thanks also for always reminding me that there is time for a bike ride.

The two translators and field assistants Habtamu Assefa and Negusu Tefera were indispensable for the field work in translating and gathering data. To all the villagers of the study area Peasant Association, who were so kind to share their way of live.

I extend my recognition to Ato Negasi who strongly assist me by GIS work, and Environmental science students, who have been in great help all the way up to the completion of this study. Finally, the unfailing encouragement, tolerance and support rend from my friends Solomon Habtewold and, all staff members of Addis college and all my families deserves particular thanks. The prayers of my mother and Father have contributed to the success of my work.

## REFERENCES

Alemneh D (2003). The Nexus of Natural Resource Degradation, Food Security and Poverty in the Ethiopian Highlands. In: Towards Sustainable Agriculture and Rural Development in the Ethiopian Highlands, pp 13-16.

- Barber R (1984). An assessment of the dominant soil degradation processes in Battlefield Park Mission Statement Plaque. Fort Harrison Headquarters. Richmond, VA. Battlefield Park Official Map and Guide.
- Bergsma E (1996). Terminology for Soil Erosion and Conservation. International Society of Soil Science, Grafisch Service Centrum, Wageningen, pp 313.
- Belay T (1992). Farmers' Perception of Erosion Hazards and Attitudes towards Soil Conservation in Gunono, Wolayita, Southern Ethiopia. *Ethiopian J. Develop. Res.* 14(2): 31-58.
- Berhanu G (2002). Policies for sustainable land management in the Highlands of Tigray, project objectives, Activities, organization and database. Summary of papers and Proceedings of a workshop, Mekelle, Ethiopia. March 28-29, 2002.
- Berhanu D (1985). The Vertisols of Ethiopia: Their properties, classification and management. *World Soil Resources Report* 56:31-54.
- Berry L (2003). Land degradation in Ethiopia: its extent and impact. Addis Ababa, Ethiopia. pp- 45
- Bull W (1997). Discontinuous ephemeral streams. *Geomorphol.* 19: 227–276.
- Campbell J (1991). Land or peasants? ; The Dilemma confronting Ethiopian resource Conservation. *Afri. Affairs*, 90( 5),21-24.
- Chadhokar PA (2000). Activate users' laws and save the land and environment. Tefetro, Newsletter of the Conservation Strategy of Ethiopia 2(2): 2–4.
- CIA (2002). The World Fact Book Ethiopia. Downloaded at: <http://www.odci.gov/cia/publications/factbook/geos/et.html>
- Constable M, and members of the Ethiopian Highland Reclamation study (1984). The degradation of resources and an evaluation of actions to combat it, Working paper 19, Ministry of agriculture, Addis Ababa, pp. 29-48.
- CSA (2004). Statistical report on farm management practices, livestock and implements. Part II. Agricultural Sample Enumeration, 2001/02 Central Statistical Authority, Addis Ababa..
- Dunne, T. and Dietrich, W. (1982). Sediment sources in tropical Conservation in the Tropics, Kussow W (ed.). American Society of Agronomy: drainage basins. Washington.
- FAO (1984). Ethiopian highlands reclamation study (EHRS). Final Report, Rome.Madison; 1(2): 41–53.
- FAO (1986). Ethiopia, Highland Reclamation study final report, Rome, 1: 1-334.
- FAO ISRIC and ISSS (1998). World Reference Base for Soil Resources. World Soil Resources Reports 84, Bulletin 8: Rome.
- Fitsum H, John P, Nega G (1999). Land Degradation in the Highlands of Tigray and Strategies for Sustainable Land Management. Addis Abeba, Ethiopia pp-92.
- Girma U (2005). Land degradation assessment in Lake Awassa catchment using GIS and Modeling. Thesis, SGS, Addis Ababa University, Addis Ababa Ethiopia pp-67.
- Girum W (2007). Assessment Of Soil Quality And Erosion Rate In Kilie Catchment, Lume Woreda, East Shoa, Ethiopia.
- Goodchild MF, Steyaert LT, Parks BO, Crane MP, Johnston CA, Maidment DR, Glendinning S (1996). GIS and Environmental Modeling. Progress and Research Issues. Fort Collins: GIS World, Inc.
- Hamelmal H (2005). Soil erosion modeling using Remote Sensing and Geographic Information System: a case study of Awassa area. Thesis, SGS, Addis Ababa University, Addis Ababa, Ethiopia.
- Harden C (1992). Incorporating roads and footpaths in watershed-scale hydrologic and soil erosion models. *Physical Geogr.* 13(4): 368–385
- Hawando T (1997). Desertification in Ethiopian Highlands. RALA report No. 200. Norwegian Church AID, Addis Ababa, Ethiopia.
- Hudson N (1996). Soil Conservation. 3rd.ed .London: BT Batsford Limited.
- Hurni H (1993). Land degradation, Famine and Land Resource Scenarios in Ethiopia.In: World Soil Erosion and Conservation, pp 27-62.
- Jimoh H (1994). Response of landuse surfaces to Erosion During intensive Rainfall in Okun Drainage Basin of Ilorin ,Nigeria .Occasional publication Series 1 of the Faculty of Business and social science ,University of Ilorin.

- Jurg k (1988). Soil conservation Research project. Rainfall, Erosivity and Isoerodent Map of Ethiopia. MOA, pp-132. Kimpe CR, Warkentin BP (1998). Soil functions and the future of natural resources. Towards sustainable land use. Furthering co-operation between people and institutions. *Adv.in Geoecol.* 1(31): 3-10.
- Kukul S (2005). Mapping Gully Erosion patterns in Foot Hills of Lower shivaliks, Punjab Agricultural university Ludhaiana, India.
- Lal R (1997). Land use and soil management effects on soil OC dynamics on Alfisols in Western Nigeria. In: Soil Processes and the Carbon Cycle, Florida. Pp. 109-126.
- Mitiku H, Kindeya G (2001). Local initiatives for planning sustainable natural resources management in Tigray, northern Ethiopia. *Ethiopian J. Natural Res.* 3: 303-326.
- Mitiku H, Herweg K, Stillhardt B (2006). Sustainable Land Management- A new Approach to Soil and Water Conservation in Ethiopia. Mekelle, Ethiopia pp-269.
- Mitiku H, Kindeya G (1998). Efforts to rehabilitate degraded lands: local initiatives for planning resource management in Tigray (Northern Ethiopia). In: Sustainable Development of Dryland Areas of East Africa.
- Moeyersons J (1991). Ravine formation on steep slopes: forward versus regressive erosion. Some case studies from Rwanda. *Catena* 18(3): 309-324.
- Montgomery D (1994). Road surface drainage, channel initiation, and slope instability. *Water Resources Res.* 30(6): 1925-1932.
- Morgan RPC (1995). Soil Erosion and Conservation. Longman Group Ltd., Essex, England.
- National Conservation Secretariat (NCS) (1994). National policy on the resource base, its utilization and planning for sustainability, National Conservation Strategy, National Conservation Strategy Secretariat, Ministry of Natural Resources Development and Environmental Protection, Addis Ababa, Ethiopia.
- Nyssen J, Moeyersons J, Poesen J, Deckers J, Mitiku H (2002). The environmental significance of the remobilisation of ancient mass movements in the Atbara-Tekeze headwaters, Northern Ethiopia. *Geomorphol.* 49: 303-322.
- Ogbaghebriel B, Brancaccio L (1993). Some reflections on the origin and landuse of pediments on Ethiopian Highlands. *Geografia Fisica e Dinamica del Quaternario* 16: 101-106.
- Oldeman LR, Hakkeing RTA, Sombroek WG (1988). Guidelines for general assessment of the status of human- induced soil degradation (GLASOD). International Soil Reference and Information Center, Wageningen.
- PASDE (2000). Building on Progress: A Plan for Accelerated and Sustained Development to End Poverty, Ministry of Finance and Economic Development (MoFED), Annual Progress Report 2006/07, Ethiopia, Addis Ababa.
- Peter HC, John RM (2002) HILLSLOPE MONITORING PROGRAM, California Department of Forestry and Fire Protection
- Poesen J, Vandaele K, Van WB. (1998). Gully erosion: importance and model implications. In Modelling Soil Erosion by Water, Boardman J, Favis-Mortlock D (eds). NATO-ASI Series I-55. Springer Verlag: Berlin; 285-311
- Rice RM, Lewis J (1991). Estimating erosion risks associated with logging and forest roads in northwestern California. *Water Resources Bulletin* 27(5): 809- 818.
- Rice RM, Tilley FB, P.A.D. (1979). A watershed's response to logging and roads: South Fork of Caspar Creek, California, 1967-1976. USDA Forest Service Research Paper PSW-146. Berkeley, California: Pacific Southwest Forest and Range Experiment Station, Forest Service, U.S. Department of Agriculture.
- Sayer J, Harcourt C, Collins N (1992). The Conservation Atlas of Tropical Forests. McMillan Publishers Ltd. UK.
- Scherr SJ, Yadav S (1996). Land degradation in the developing world Implications for food agriculture, and the environment to 2020. International Food policy research institute Washington, D.C. USA
- Scoones I, Reij C, Toulmin C (1996). Sustaining the Soil. In: Sustaining the Soil. Indigenous Soil and Water Conservation in Africa, PP: 1-27, (Scoones, I. And Toulmin, C. eds.). Earthscan Publications Ltd. London.
- Shrestha H (2002). Green Road Concept to Minimize the mass wasting and post construction Landslides along hill roads. International Symposium, Landslide Hazard in Orogenic Zone from the Himalaya to Island Arc in Asia, Kathmandu, Nepal, Proceedings, pp. 335-344.
- Stocking M, Murnaghan N, (2000). Land degradation- Guidelines for field assessment. Overseas Development Group. University of East Anglia. Norwich, UK
- United Nations Environment Programme (UNEP) (1986). Farming systems principles for improved food production and the control of soil degradation in the arid, semi-arid, and humid tropics. Hyderabad, India.